


<b>Last Modified:</b> 6-2-2008	5.1 G	<b>From:</b> 200601
<b>Model Year:</b> 2007	<b>Model:</b> Camry	<b>Doc ID:</b> RM0000022NO001X
<b>Title:</b> 2GR-FE ENGINE CONTROL SYSTEM: KNOCK SENSOR: INSPECTION (2007 Camry)		

## INSPECTION

### 1. INSPECT KNOCK CONTROL SENSOR

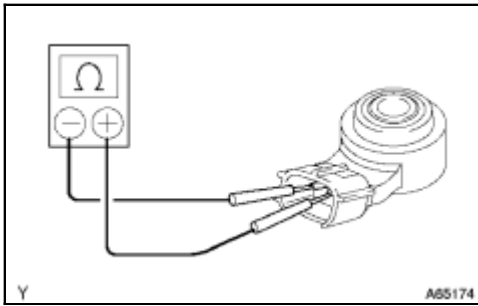

(a) Using an ohmmeter, measure the resistance between the terminals.

Standard resistance:  
120 to 280 k $\Omega$  at 20°C (68°F)

If the result is not as specified, replace the sensor.

